


## Maglia di transizione BW

BW Transition link

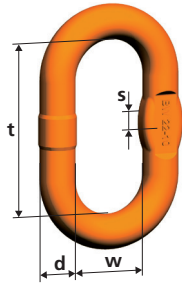

Tipo Type	Portata 0°-45° WLL 0°-45°  Kg	Dimensioni Dimensions				Peso Weight  Kg	Maglia per catena Ø Transition link for chain Ø  1-2 br. 1-2 legs
		d mm	t mm	w mm	s mm		
BW 7	1000	7	36	16	7	0,03	5
BW 8*	1400	8	36	16	-	0,03	6
BW 9	1900	9	44	20	-	0,07	7
BW 10	2500	10	44	20	-	0,09	8
BW 13	4000	13	54	25	10	0,17	10
BW 16	6700	17	70	34	14	0,36	13
BW 20	10000	20	85	40	14	0,68	16
BW 22	12500	23	115	50	17	1,16	-
BW 23*	14000	23	115	45	17	1,15	19
BW 26	16200	27	140	65	20	1,92	-
BW 27*	19000	27	140	55	20	1,92	22
BW 32	26500	33	150	70	26	3,16	26
BW 36	31000	36	170	75	-	4,12	-
BW 40	40400	40	170	80	-	5,37	32
BW 45	42400	45	170	80	-	7,15	-
BW 50	64000	50	200	100	-	10,8	-

\* Solo con brache saldate.

\* Only in welded slings.